




aerospace
climate control
electromechanical
filtration
fluid & gas handling
hydraulics
pneumatics
process control
sealing & shielding



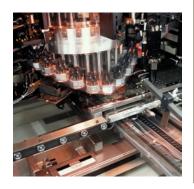

# **PSD1 Parker Servo Drive**

Standalone Servo Drive and Multi-axis Servo System





# 北京润诚时代科技有限公司

自动化事业部

地址:北京市朝阳区汤立路218号C座968室

邮编:100012

电话:010-84450370 传真:010-84450371

网址: www.runcheng.net





#### WARNING - USER RESPONSIBILITY

FAILURE OR IMPROPER SELECTION OR IMPROPER USE OF THE PRODUCTS DESCRIBED HEREIN OR RELATED ITEMS CAN CAUSE DEATH, PERSONAL INJURY AND PROPERTY DAMAGE.

- This document and other information from Parker-Hannifin Corporation, its subsidiaries and authorized distributors provide product or system options for further investigation by users having technical expertise.
- The user, through its own analysis and testing, is solely responsible for making the final selection of the system
  and components and assuring that all performance, endurance, maintenance, safety and warning requirements of
  the application are met. The user must analyze all aspects of the application, follow applicable industry standards,
  and follow the information concerning the product in the current product catalog and in any other materials
  provided from Parker or its subsidiaries or authorized distributors.
- To the extent that Parker or its subsidiaries or authorized distributors provide component or system options based upon data or specifications provided by the user, the user is responsible for determining that such data and specifications are suitable and sufficient for all applications and reasonably foreseeable uses of the components or systems.

# Parker Servo Drive - PSD

| Overview   | 5  |
|--|----|
| PSD Overview                                       | 6  |
| Technical Characteristics                          | 8  |
| Technical Data                                     |    |
| Environmental Characteristics                      | 9  |
| Standards & Conformance                            | 9  |
| Dimensions   | 9  |
| Specific Functionalities                           | 10 |
| Safety configuration                               | 10 |
| Specific control feature for high dynamic machines | 10 |
| Order Code   | 11 |
| ParkerServo Drive PSD1                             | 11 |

# **Parker Hannifin**

# The global leader in motion and control technologies

### A world class player on a local stage

#### **Global Product Design**

Parker Hannifin has more than 40 years experience in the design and manufacturing of drives, controls, motors and mechanical products. With dedicated global product development teams, Parker draws on industry-leading technological leadership and experience from engineering teams in Europe, North America and Asia.

#### **Local Application Expertise**

Parker has local engineering resources committed to adapting and applying our current products and technologies to best fit our customers' needs.

#### Manufacturing to Meet Our Customers' Needs

Parker is committed to meeting the increasing service demands that our customers require to succeed in the global industrial market. Parker's manufacturing teams seek continuous improvement through the implementation of lean manufacturing methods throughout the process. We measure ourselves on meeting our customers' expectations of quality and delivery, not just our own. In order to meet these expectations, Parker operates and continues to invest in our manufacturing facilities in Europe, North America and Asia.

# Electromechanical Worldwide Manufacturing Locations

#### **Europe**

Littlehampton, United Kingdom Dijon, France Offenburg, Germany Filderstadt, Germany Milan, Italy

#### Asia

Wuxi, China Jangan, Korea Chennai, India

#### **North America**

Rohnert Park, California Irwin, Pennsylvania Charlotte, North Carolina New Ulm, Minnesota



Offenburg, Germany

# Local Manufacturing and Support in Europe

Parker provides sales assistance and local technical support through a network of dedicated sales teams and authorized technical distributors throughout Europe.

For contact information, please refer to the Sales Offices on the back cover of this document or visit www.parker.com



Milan, Italy



Littlehampton, UK



Filderstadt, Germany



Dijon, France

# Parker Servo Drive - PSD

# **Overview**

## **Description**

The PSD1 is Parker Servo Drive family, available with different power rating from 2 to 30A and form factors. Today the offering contains:

The PSD1-S is a standalone drive which can be connected directly to the main supply.

The PSD1-M is a multi-axis servo system where each axis module can supply up to three servo motors. The base configuration consists of a common DC bus supply and multiples PSD1-M modules, connected through DC bus bars. The modules are available as one, two or three axis versions. This makes the system highly flexible.

PSD1-M servo system is particularly suitable for all centralised automation systems, such as those found in many packaging machines, where large numbers of drives are often required offering significant advantages.

- · Packaging machines
- Material forming machines
- · Handling machines
- · General automation

#### **Common Features**

- Hiperface DSL feedback ®
   Reduced cabling; only one cable connection between drive & motor
- EtherCAT / PROFINET communication
- Quick and simple wiring
- Removable SD card
- Same software functionalities for standalone drive and multi-axis servo system

#### PSD1-S unique features

- · Single or three phases power supply
- · Compact housing
- · Particularly suitable for small machines

#### PSD1-M unique features

- The most compact multi-axis servo system on the market
- One, two or three axis versions combined in one housing
- Common DC bus connection for energy exchange between drives



#### Technical characteristics - Overview

| Standalone axis PSD1 S | Continuous current [A <sub>rms</sub> ] | Peak current<br>A (≤ 2 s) |  |  |
|------------------------|--|---------------------------|--|--|
| PSD1 SW1200            | 2                                      | 6                         |  |  |
| PSD1 SW1300            | 5                                      | 15                        |  |  |



| Multi axis<br>PSD1 M | Continuous current [A <sub>rms</sub> ] | Peak current<br>A (≤ 2 s) |
|----------------------|--|---------------------------|
| PSD1 MW1300          | 5                                      | 10                        |
| PSD1 MW1400          | 8                                      | 16                        |
| PSD1 MW1600          | 15                                     | 30                        |
| PSD1 MW1800          | 30                                     | 60                        |
| PSD1 MW2220          | 2 + 2                                  | 4 + 4                     |
| PSD1 MW2330          | 5 + 5                                  | 10 + 10                   |
| PSD1 MW2440          | 8 + 8                                  | 16 + 16                   |
| PSD1 MW2630          | 15 + 5                                 | 30 + 10                   |
| PSD1 MW3222          | 2 + 2 + 2                              | 4 + 4 + 4                 |
| PSD1 MW3433          | 8 + 5 + 5                              | 16 + 10 + 10              |

(additional module on request)

# **PSD Overview**

## **Applications**

PSD1-M has been developed for all applications where multiple drives are normally used and gives both OEMs and end users the opportunity to reduce build, configuration and operating costs, whilst boosting productivity and profitability.



Typical applications for PSD1-M include packaging machines, material forming machines, textile, paper, converting and plastics machines, where large numbers of axes are required.





## **High speed communication**

- · Communication over Ethernet
- Onboard connection



#### Inputs / Outputs

- PSD offers 4 fast digital inputs and 2 digital outputs per axis.
- Connection via fast and simple push-in direct plug-in technology.



#### **Optional Motor Feedback**

• Resolver, Endat 2.2, Biss C



#### **Quick and Simple Wiring**

- Single cable connection between drive and SMH motor
- Reduction in wiring costs
- Increase reliability






## Reduce machine footprint


- Up to 3 axis in one single housing
- Reduce the size of the cabinet
- $\bullet$  Electronics footprint is up to 40 %smaller than traditional solutions



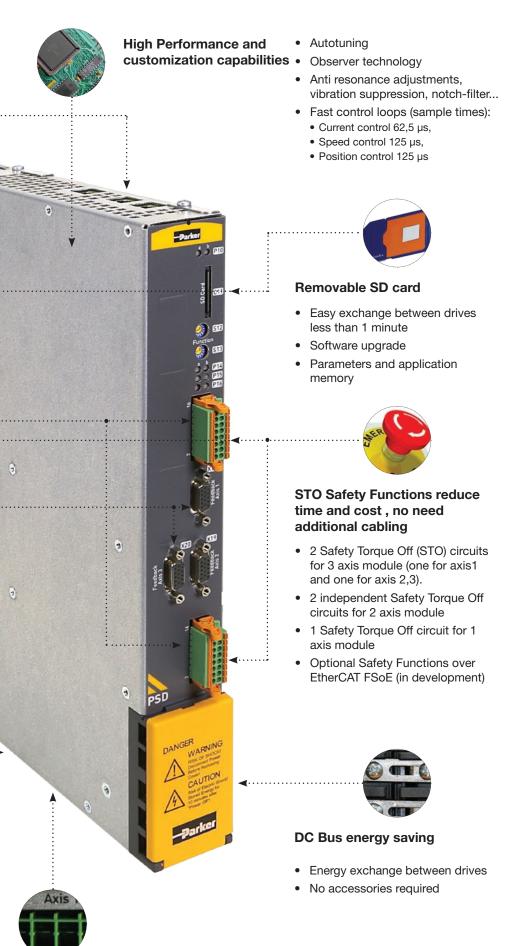

## PSD Configuration Plug-in

With the help of the Parker
Automation Manager (PAM) all
ongoing tasks can be managed.
Based on the PAM framework a
complete integrated tool is available.
The set-up and commisioning of
the drive can be done easily using
the wizard based configuration tool.
Parker motors will be recognized by a
electronic nameplate. Technical data
for the Parker linear actuators such
as ETH, HPLA etc are available in
database.

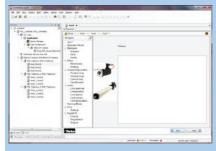

#### Configuration / parameterization

- Wizard-guided query of all necessary inputs
- Graphically supported selection
- Reference to mechanical system / application

#### Diagnostics / maintenance / service

- Complete support of diagnostics and analysis functions
- Test functions
- 4-channel oscilloscope
- Signal tracking directly on the PC
- Various modes (single/normal/ auto/roll)
- Zoom function
- Export as image or table (for example to Excel)
- Enhanced optimisation possibilities for the drive technology Set-up
- Predefined motion profiles
- Convenient operation
- Automatic determination of the moment of inertia

# **Technical Characteristics**

## Technical Data

### **PSD1 SW Standalone Axis**

|     | Туре                   |     | Standalone Axis   |        |  |  |  |  |  |
|-----|------------------------|-----|---|--------|--|--|--|--|--|
|     | Input voltage          | VAC | 3*230 VAC ±10 % 5060 Hz<br>1*230 VAC ±10 % 5060 Hz<br>30253 VAC |        |  |  |  |  |  |
|     | PWM Frequency nom.     | kHz | 8   | 8      |  |  |  |  |  |
| -   | Possible PWM frequency | kHz | 4/8/16  | 4/8/16 |  |  |  |  |  |
| (8) | Continuous current     | Α   | 2   | 5      |  |  |  |  |  |
|     | Peak current (≤ 2 s)   | Α   | 6   | 15     |  |  |  |  |  |

#### **PSD1 MW Multi-Axis Module**

| Туре                   |     | Single Axis                                 |        |        |        |  |  |  |  |
|------------------------|-----|---|--------|--------|--------|--|--|--|--|
| DC Bus voltage         | VDC | 325680 VDC ±10 %<br>(Rated voltage 560 VDC) |        |        |        |  |  |  |  |
| PWM Frequency nom.     | kHz | 8 8 4 4                                     |        |        |        |  |  |  |  |
| Possible PWM frequency |     | 4/8/16                                      | 4/8/16 | 4/8/16 | 4/8/16 |  |  |  |  |
| Continuous current     | Α   | 5   | 8      | 15     | 30     |  |  |  |  |
| Peak current (≤ 2 s)   | Α   | 10  | 16     | 30     | 60     |  |  |  |  |

|    | Туре                   | Twin Axis |   |         |         |         |  |  |  |  |
|----|------------------------|-----------|---|---------|---------|---------|--|--|--|--|
|    | DC Bus voltage         | VDC       | 325680 VDC ±10 %<br>(Rated voltage 560 VDC) |         |         |         |  |  |  |  |
| -  | PWM Frequency nom.     | kHz       | 8   | 8       | 8       | 4       |  |  |  |  |
| 8  | Possible PWM frequency | kHz       | 4/8/16                                      | 4/8/16  | 4/8/16  | 4/8/16  |  |  |  |  |
|    | Continuous current*    | Α         | 2 + 2                                       | 5 + 5   | 8 + 8   | 15 + 5  |  |  |  |  |
| 15 | Peak current (≤ 2 s)   | Α         | 4 + 4                                       | 10 + 10 | 16 + 16 | 30 + 10 |  |  |  |  |

|   | Туре                   |     | Triple Axis                                 |              |  |  |  |  |  |
|---|------------------------|-----|---|--------------|--|--|--|--|--|
|   | DC Bus voltage         | VDC | 325680 VDC ±10 %<br>(Rated voltage 560 VDC) |              |  |  |  |  |  |
|   | PWM Frequency nom.     | kHz | 8   | 8            |  |  |  |  |  |
| 8 | Possible PWM frequency | kHz | 4/8/16                                      | 4/8/16       |  |  |  |  |  |
|   | Continuous current*    | Α   | 2 + 2 + 2                                   | 8 + 5 + 5    |  |  |  |  |  |
|   | Peak current (≤ 2 s)   | Α   | 4 + 4 + 4                                   | 16 + 10 + 10 |  |  |  |  |  |

<sup>\*</sup>with an continuous limit current at 16A max. by module

## PSD1-MW-P - Power Supply Unit

#### Mains Supply

| Mains Supply             |       |              |  |     |        |                   |        |              |     |     |                          |     |     |
|--------------------------|-------|--------------|--|-----|--------|-------------------|--------|--------------|-----|-----|--------------------------|-----|-----|
| Power Supply Type        | Unit  | PSD1 MW P010 |  |     | LCG-00 | with<br>)30-0,86ı | mH-UL* | PSD1 MW P020 |     |     | with<br>LCG-0055-0,45mH* |     |     |
| Input Voltage            |       |              | 3*230 480 VAC ±10 % 5060 Hz<br>(Rated voltage 3*400 VAC) |     |        |                   |        |              |     |     |                          |     |     |
| Output Voltage           |       |              | 325680 VDC ±10 %<br>(Rated voltage 560 VDC)              |     |        |                   |        |              |     |     |                          |     |     |
| Supplied Voltage         | [VAC] | 230          | 400  | 480 | 230    | 400               | 480    | 230          | 400 | 480 | 230                      | 400 | 480 |
| <b>Output Power</b>      | [kVA] | 6            | 6 10 10 9 15 15 12 20 20 19 30 30                        |     |        |                   |        |              |     | 30  |                          |     |     |
| Peak Output Power (<5 s) | [kVA] | 12           | 20   | 20  | 18     | 30                | 30     | 24           | 40  | 40  | 36                       | 60  | 60  |

## **Control Supply**

| Rated Input Voltage   |     |       | 24 VDC ±10 % |       |       |  |  |  |  |  |
|-----------------------|-----|-------|--------------|-------|-------|--|--|--|--|--|
| Maximum Ripple        |     |       | $1 V_{pkpk}$ |       |       |  |  |  |  |  |
| <b>Supply Current</b> | [A] | 0.2 A | 0.8A         | 0.3 A | 0.3 A |  |  |  |  |  |

<sup>(1)</sup> Operation of the P010 and P020 power supplies with additional line choke (to be ordered separately).

## **Environmental Characteristics**


| <b>Operating Temperature</b> | 0+40 °C   |
|------------------------------|---|
| Storage Temperature          | -25 °C+70 °C  |
| <b>Shipping Temperature</b>  | -25 °C+70 °C  |
| Product Enclosure Rating     | IP20 (only in closed electrical cabinet) UL open type equipment                 |
| Altitude                     | 1000 m ASL. Derate output current by 1.0 % per 100 m to a maximum of 2000 m     |
| <b>Operating Humidity</b>    | Class 3K3 - Maximum 85 % non-condensing   |
| Storage Humidity             | Class 1K3 - Maximum 95 % non-condensing   |
| <b>Shipping Humidity</b>     | Class 2K3 - Maximum 95 % at 40 °C   |
| Operating Vibration          | IEC60068-2-6<br>1057 Hz width 0.075 mm<br>57150 Hz accel. 9.81 m/s <sup>2</sup> |


# Standards & Conformance


| 2006/95/EC   | Low voltage directive   |
|--------------|---|
| EN 60204-1   | Safety of machinery - Electrical equipment of machines - Part 1: General requirements                         |
| EN 61800-5-1 | Adjustable speed electrical power drive systems - safety requirements, thermal and energy                     |
| UL           | Power Conversion Equipment UL508C   |
| 2004/108/EC  | EMC directive   |
| EN 61800-3   | Adjustable speed electrical power drive systems - Part 3: EMC product standard including specific test method |
| STO          | Performance Level PL=e according to EN ISO 13849  |

# **Dimensions**

| Туре                     | H<br>[mm] | H1<br>[mm] | H2<br>[mm] | W<br>[mm] | D<br>[mm] | Weight<br>[kg] |
|--------------------------|-----------|------------|------------|-----------|-----------|----------------|
| PSD1-SW                  | 235       | 225        | 200        | 50        | 180       | 1.8            |
| PSD1-MW 1/2/3 axes       | 432       | 405        | 360        | 50        | 263       | 4.3            |
| PSD1-MW Single axis 30 A | 432       | 405        | 360        | 100       | 263       | 8.6            |
| PSD1-MW-P-010            | 432       | 405        | 360        | 50        | 263       | 3.6            |
| PSD1-MW-P-020            | 432       | 405        | 360        | 100       | 263       | 5.4            |

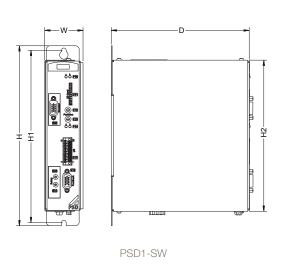

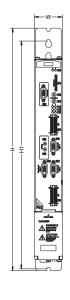


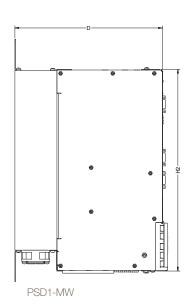

# **Specific Functionalities**

## Safety configuration

The Parker Servo Drives have featured "Safe Torque Off" (STO) as standard function, helping to protect users and machinery against unexpected motor start-up. Performance Level PL=e according to EN ISO 13849. In order to fulfil the new machinery directive 2006/42/EG, the PSD can be equipped with a safety option board. The system does not need any additional wiring, as the Functional Safety over EtherCAT (FSoE)\* uses the existing wiring.

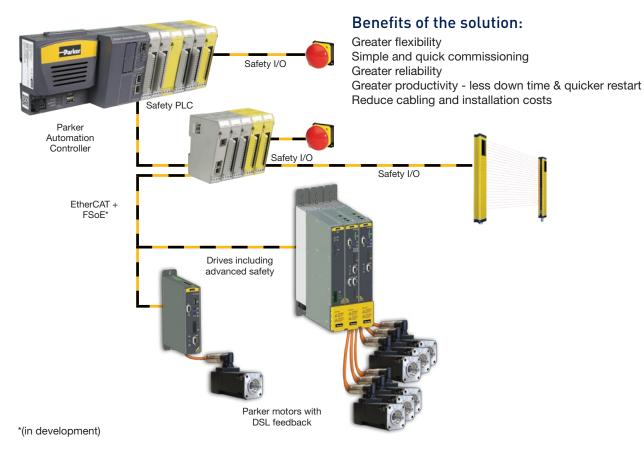


## Specific control feature for high dynamic machines

#### Vibration suppression

New machines need increasingly higher clock rates, but highly dynamic setvalue changes stimulate mechanical resonance of the machine. Mechanical vibrations lead to quality loss and/or reduced clock rates

=> Vibration suppression helps to boost the performance of your machine

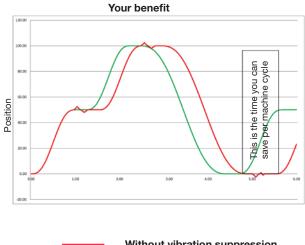

Without vibration suppression
With vibration suppression

# **Order Code**

# ParkerServo Drive PSD1

|               | 1    | 2 | 3 | 4 | 5   | 6 | 7 | 8 | 9 | 10 | 11  |
|---------------|------|---|---|---|-----|---|---|---|---|----|-----|
| Order example | PSD1 | M | W | 3 | 433 | В | 1 | 1 | 0 | 0  | 000 |

| 1 | Drive Family                 |                    |  |  |  |  |  |
|---|------------------------------|--------------------|--|--|--|--|--|
|   | PSD1                         | Parker Servo Drive |  |  |  |  |  |
| 2 | Device Type                  |                    |  |  |  |  |  |
|   | S                            | Standalone 230VAC  |  |  |  |  |  |
|   | М                            | Multi-axis 400VAC  |  |  |  |  |  |
| 3 | <b>Mounting T</b>            | Mounting Type      |  |  |  |  |  |
|   | W                            | Wall mounting      |  |  |  |  |  |
|   | С                            | Cold plate*        |  |  |  |  |  |
|   | Р                            | Push through IP20* |  |  |  |  |  |
| 4 | <b>Device Type</b>           | Device Type        |  |  |  |  |  |
|   | 1                            | One powerstage     |  |  |  |  |  |
|   | 2                            | Two powerstages    |  |  |  |  |  |
|   | 3                            | Three powerstages  |  |  |  |  |  |
|   | Р                            | Power module       |  |  |  |  |  |
| 5 | Device Type                  |                    |  |  |  |  |  |
|   | PSD1SW1 Standalone           |                    |  |  |  |  |  |
|   | 200                          | 2 Ampere           |  |  |  |  |  |
|   | 300                          | 5 Ampere           |  |  |  |  |  |
|   | PSD1MW1 One powerstage       |                    |  |  |  |  |  |
|   | 300                          | 5 Ampere           |  |  |  |  |  |
|   | 400                          | 8 Ampere           |  |  |  |  |  |
|   | 600                          | 15 Ampere          |  |  |  |  |  |
|   | 800                          | 30 Ampere*         |  |  |  |  |  |
|   | PSD1MW2                      | Two powerstages    |  |  |  |  |  |
|   | 220                          | 2 + 2 Ampere       |  |  |  |  |  |
|   | 330                          | 5 + 5 Ampere       |  |  |  |  |  |
|   | 440                          | 8 + 8 Ampere       |  |  |  |  |  |
|   | 630                          | 15 + 5 Ampere*     |  |  |  |  |  |
|   | PSD1MW3 Three powerstages    |                    |  |  |  |  |  |
|   | 222                          | 2 + 2 + 2 Ampere   |  |  |  |  |  |
|   | 433                          | 8 + 5 + 5 Ampere   |  |  |  |  |  |
|   | PSD1MWP Passive power supply |                    |  |  |  |  |  |
|   | 010                          | 10 kVA             |  |  |  |  |  |
|   | 020                          | 20 kVA             |  |  |  |  |  |
|   |                              |                    |  |  |  |  |  |

| 6  | <b>Technology</b> |                                  |  |  |
|----|-------------------|----------------------------------|--|--|
|    | В                 | Basic                            |  |  |
| 7  | Interface         |                                  |  |  |
|    | 1                 | EtherCAT                         |  |  |
|    | 2                 | PROFINET                         |  |  |
|    | 3                 | Ethernet/IP*                     |  |  |
| 8  | Feedback          |                                  |  |  |
|    | 1                 | DSL                              |  |  |
|    | 2                 | EnDat 2.2*                       |  |  |
|    | 3                 | BiSS C*                          |  |  |
|    | 4                 | Resolver*                        |  |  |
| 9  | Option 1          |                                  |  |  |
|    | 0                 | No option                        |  |  |
|    | 1                 | Functional Safety over Ethercat* |  |  |
| 10 | Option 2          |                                  |  |  |
|    | 0                 | No option                        |  |  |
| 11 | Customisation     |                                  |  |  |
|    | 000               | Non customized                   |  |  |

Note: in bold, reference already available \* in development

We reserve the right to make technical changes. The data correspond to the technical state at the time of printing. © 2016 Parker Hannifin Corporation. All rights reserved.

192-010001N3

July 2016





# 北京润诚时代科技有限公司

自动化事业部

地址:北京市朝阳区汤立路218号C座968室

邮编:100012

电话:010-84450370 传真:010-84450371

网址: www.runcheng.net

Your local authorized Parker distributor